




Professional Torque Tester

PRO-TEST 60, 400 & 1500 series 2

OPERATOR'S HANDBOOK (PART No 34299) Issue 2
(ENGLISH)

FOR USE WITH PRO-TEST'S FITTED WITH VERSION 37701.301 SOFTWARE

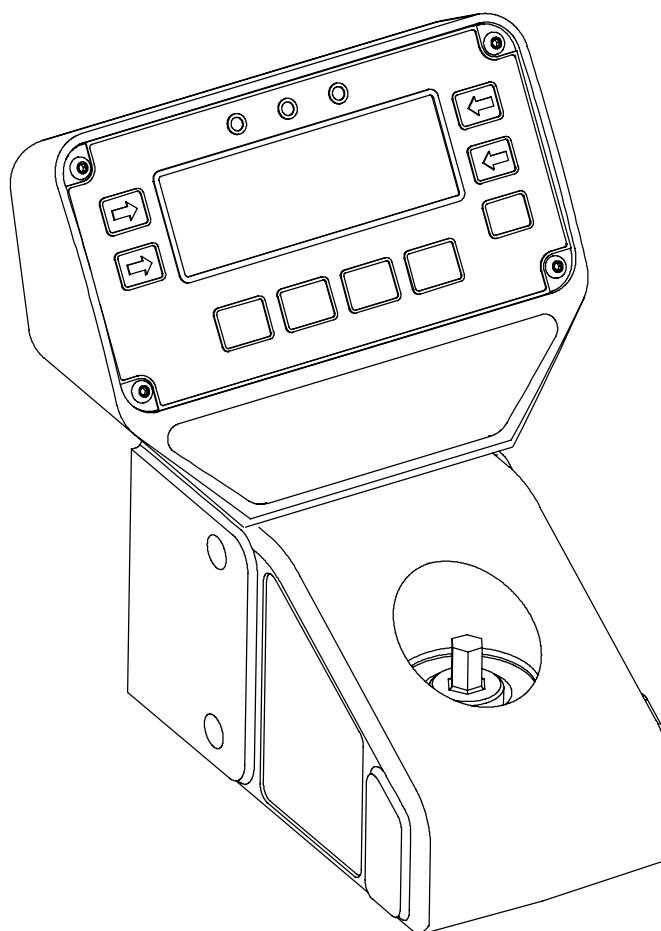

MODEL NUMBERS COVERED BY THIS MANUAL

43218 PRO-TEST 60 series 2 TRANSDUCER & DISPLAY
43219 PRO-TEST 400 series 2 TRANSDUCER & DISPLAY
43220 PRO-TEST 1500 series 2 TRANSDUCER & DISPLAY

NORBAR TORQUE TOOLS LTD, Beaumont Road, Banbury, Oxfordshire, OX16 7XJ, UNITED KINGDOM
Tel : + 44 (0) 1295 270333, Fax : + 44 (0) 1295 753643


www.norbar.com

enquiry@norbar.com

CONTENTS


	<u>PAGE</u>
Introduction	2
Assembly diagram	2
Parts included	3
Accessories	3
Features and Functions	4
Operating Instructions	5
1. Mounting positions	5
2. Locating display housing	6
3. Connecting power supply	6
4. Switching ON	6
5. Selecting measurement units	7
6. Selecting measurement mode	7
7. Fitting hex drive adapter	7
8. Operating tool to be calibrated / tested	7
Set Up	8
1. Language	8
2. Limits	8
3. Units	9
4. Serial Port	9
5. Thresholds	9
6. Modes	9
Limits	10
ISO 6789:2003	10
NON ISO 6789:2003	11
Operation	11
Status Indication	11
Serial Port	12
Introduction	12
Parameters	12
Hyper Terminal ®	13
Limit Output	13
Pin Connections	13
Data Output Example	13
Connector Type	13
Connecting Lead	13
Specifications	14
Maintenance	15
Pro-Test Calibration	15
Cleaning	15
Disposal (Recycling considerations)	15

INTRODUCTION

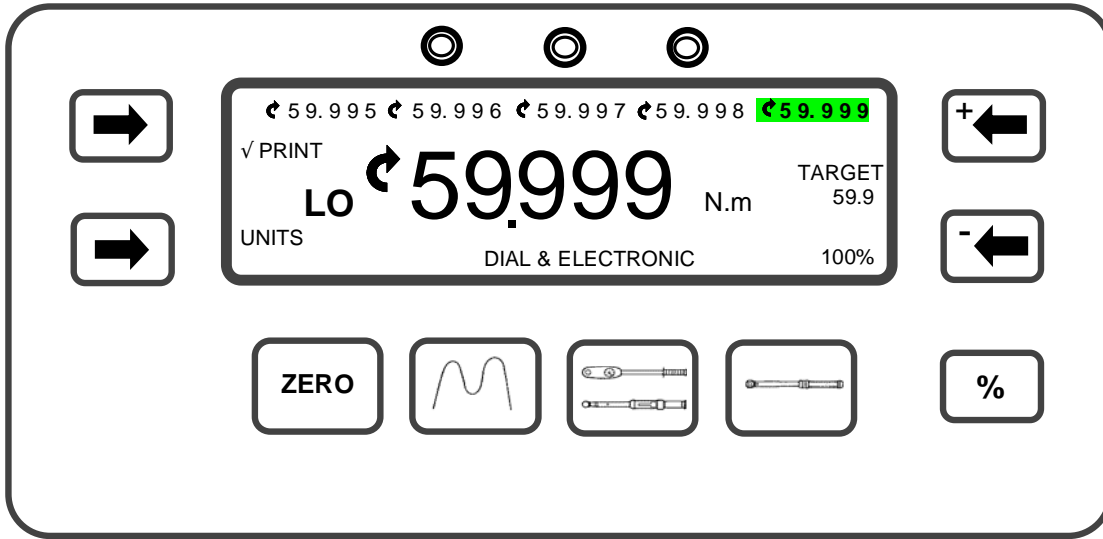

The Professional Torque Tester (Pro-Test) has been designed as an accurate, cost effective and easy to operate instrument for calibrating and testing all types of torque wrenches.

ASSEMBLY DIAGRAM:-

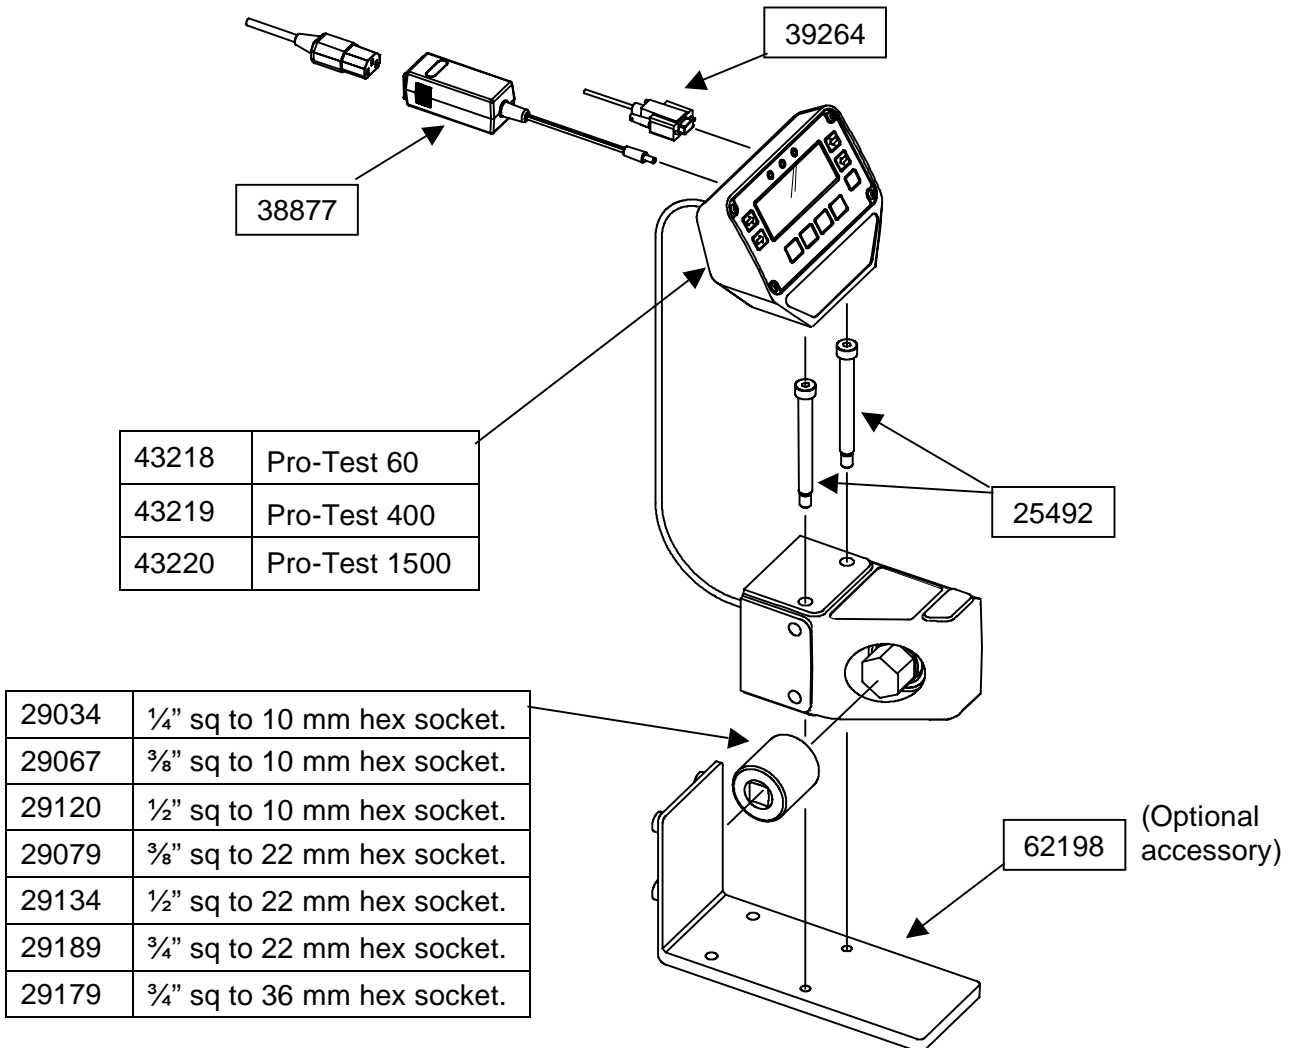

PARTS INCLUDED:- _____


Pro-Test Instrument	Part Number	Pro-Test 60 Part Number 43218	Pro-Test 400 Part Number 43219	Pro-Test 1500 Part Number 43220
2 off M10 x 100mm long screw.	25492	✓	✓	✓
6 mm hex key.	24937	✓	✓	✓
1/4" sq to 10 mm hex socket.	29034	✓	-	-
3/8" sq to 10 mm hex socket.	29067	✓	-	-
1/2" sq to 10 mm hex socket.	29120	✓	-	-
3/8" sq to 22 mm hex socket.	29079	-	✓	-
1/2" sq to 22 mm hex socket.	29134	-	✓	-
3/4" sq to 22 mm hex socket.	29189	-	✓	-
3/4" sq to 36 mm hex socket.	29179	-	-	✓
Operators Handbook.	34299	✓	✓	✓
Calibration certificate.		✓	✓	✓
Quick reference card(s).	34302	✓	✓	✓
Serial data lead.	39264	✓	✓	✓
Power supply.	38877	✓	✓	✓
Power cable.		✓	✓	✓
Carry case.	60249	✓	✓	✓

ACCESSORIES:- _____

Part Number	Description
62198	Mounting bracket.
60253	12v DC power supply (in vehicle power adapter).
29190	1" to 36mm socket (for use with Pro-Test 1500).
60248	Serial Data Lead Kit.

FEATURES AND FUNCTIONS

- ▶ 3 sizes available covering the calibration ranges of:
 - 1.2 to 60 Nm.
 - 8 to 400 Nm.
 - 30 to 1500 Nm.
- ▶ 5 digit resolution.
- ▶ ISO 6789:2003 limit mode with single press selection for 20%, 60% & 100% target values.
- ▶ NON ISO 6789:2003 limit mode with user defined tolerances.
- ▶ The pictorial keys allow direct access to measurement modes.

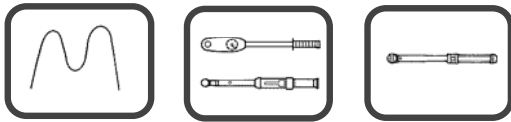

- ▶ Serial Port Connector for data output to PC's or printers.
- ▶ PRINT/NO PRINT (✓ PRINT/X PRINT) feature for control of serial port output.
- ▶ The last 5 readings taken are memorised on the display.
- ▶ SET UP menu's for:
 - Language of operation,
 - Limits mode required,
 - Units of measurement enabled/disabled,
 - Serial port communication parameters,
 - Thresholds for 'CLICK & CAM' mode,
 - Modes of measurement enabled/disabled.

OPERATING INSTRUCTIONS


If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

1. MOUNTING POSITIONS:-

Securely mount the Pro-Test transducer in the plane of operation required with the 2 fixing bolts supplied. This can be to a bench top, wall, or the mounting bracket part number 62198 (not included).


CLOCKWISE ONLY CALIBRATING / TESTING

Torque tighten to 20 N.m.
(or hand tighten bolts with hex key provided)

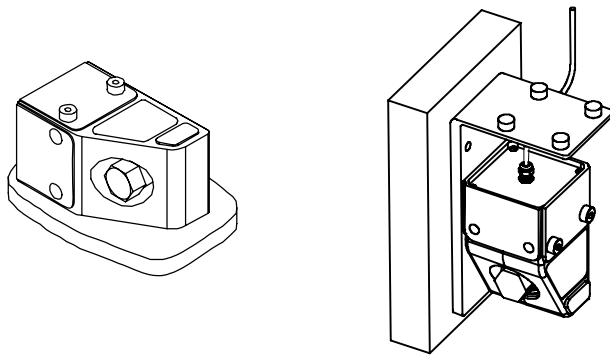

ANTI-CLOCKWISE ONLY CALIBRATING / TESTING


Torque tighten to 20 N.m.
(or hand tighten bolts with hex key provided)

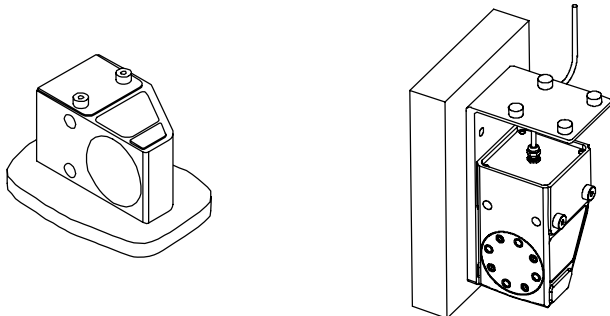

CLOCKWISE AND ANTI-CLOCKWISE CALIBRATING / TESTING

IMPORTANT !




Bolts must be torque tightened to 50 N.m.
Replace bolts (part number 25492) if removed.

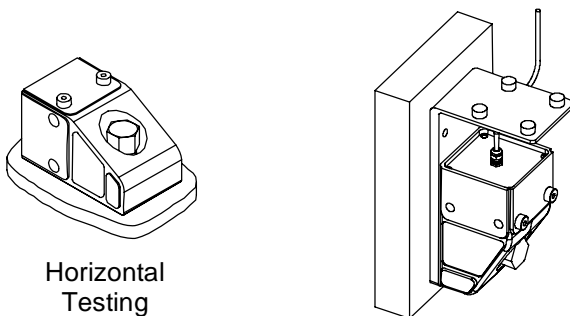

Horizontal
Testing


IMPORTANT !

The whole of the transducer must always be in contact with the supporting surface.

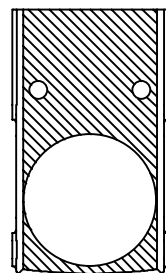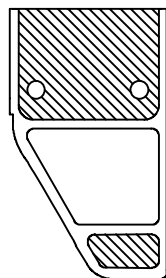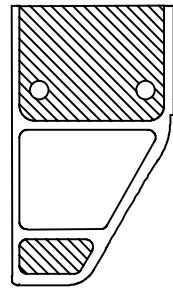

2. LOCATING DISPLAY HOUSING:- _____

Locate Pro-Test Display housing on to the bolt heads securing the transducer housing. The display housing and transducer housing can also be secured on to a mounting bracket part number 62198 (not included).

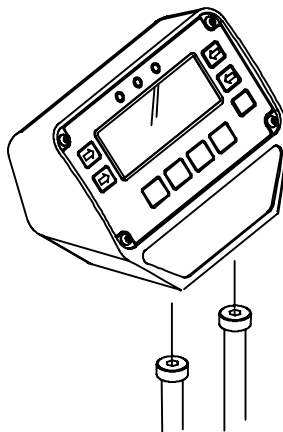

3. CONNECTING POWER SUPPLY:- _____

Plug Power Supply into back of display housing then plug power cable into Power Supply.




TIP. If the power cable has no plug fitted, wire as follows:
 BROWN-LIVE BLUE-NEUTRAL GREEN / YELLOW-EARTH
 If in doubt consult a qualified electrician.

4. SWITCHING ON:- _____

Switch ON Pro-Test ('I' in the down position).

WARNING! ALLOW PRO-TEST TO EQUALISE TO THE AMBIENT TEMPERATURE/ HUMIDITY BEFORE SWITCHING ON. WIPE OFF ANY MOISTURE BEFORE USE.

TIP. No display when power is switched on.
 a) Check the Power Supply output connector is correctly plugged into the mating part on the back of the display housing.
 b) Check the fuse in the power cable plug.
 c) Check that the green LED is illuminated on the power supply

Mode	Use	How it works.	Visual representation
 TRACK	Allow 5 minutes for the instrument to warm up and stabilise, then press  ZERO	Follows signal.	

TIP. For maximum accuracy exercise the transducer in the direction of use before pressing 'ZERO'.

5. SELECTING MEASUREMENT UNITS:- _____

 

Select required units of measurement. Pressing and releasing the 'UNITS' button will step onto the next available unit of measurement.



TIP. Required units of measurement are not selectable.

- a) Conversion cannot be displayed within available digits on display, thus conversion is not allowed.
- b) Units required have been disabled. See SET UP.

6. SELECTING MEASUREMENT MODE:- _____

Press required button, see below:

Button	Use	How it works.	Visual representation
 DIAL & ELECTRONIC	Bending beam wrenches & Dial type wrenches.	Hold highest signal. Reset by pressing <div style="border: 1px solid black; border-radius: 10px; width: 40px; height: 40px; text-align: center; margin: 0 auto; padding: 5px;">ZERO</div>	

 Button	Use	How it works.	Visual representation
 CLICK & CAM	Preset (click type) wrenches.	Captures the FIRST PEAK of torque and displays this for the selected AUTO RESET HOLD TIME before automatically resetting.	

TIP. Readings in CLICK & CAM mode are inconsistent.

Change FIRST PEAK SENSITIVITY to be less sensitive, see THRESHOLDS menu in SET UP.


7. FITTING HEX DRIVE ADAPTER:- _____

Fit adapter supplied to hex drive of transducer. Fit the tool to be calibrated / tested to the square drive of the adapter.

8. OPERATE TOOL TO BE CALIBRATED / TESTED:- _____

Apply force to tool smoothly (do not snatch). Follow instructions for torque tool being tested.

SET UP

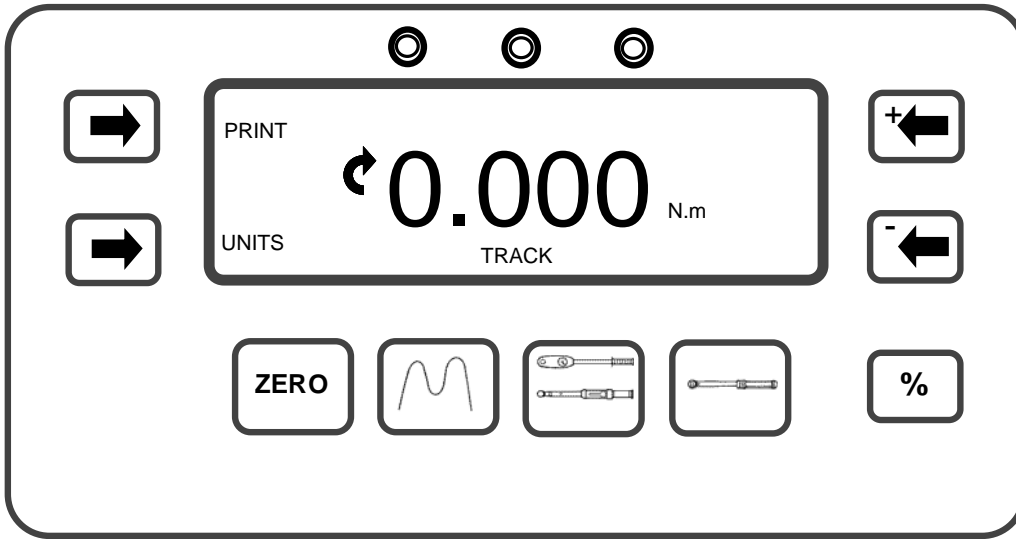


To enter SET UP, press 'UNITS' & 'PRINT' buttons simultaneously upon which the 'SOFTWARE VERSION NUMBER' will be displayed for 2 seconds.

1. LANGUAGE




Press '↓' to select.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

2. LIMITS

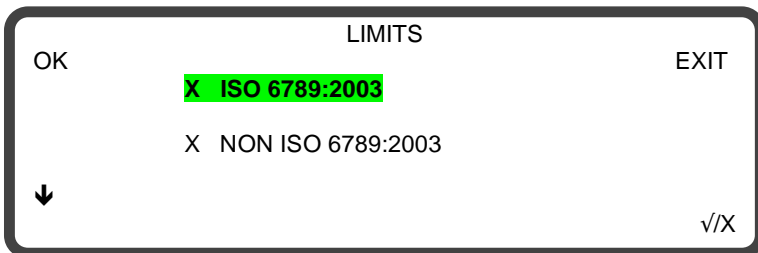

Press '↓' to select.
Press '√/X' to enable/disable.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

TIP. If NON ISO 6789:2003 limit mode is enabled, 'OK' or 'EXIT' will go to the SET LIMITS menu (shown below).

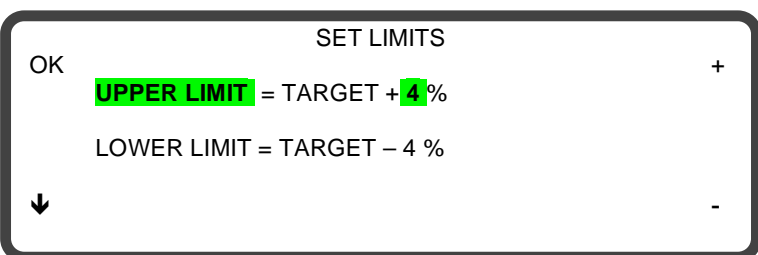

Press '↓' to select.
Press '+' or '-' to change the value displayed.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

3. UNITS


UNITS		
OK		EXIT
√ N.m	√ ozf.in	√ Kgf.cm
√ dN.m	√ ft.lb	√ gf.m
√ cN.m	√ in.lb	√ gf.cm
√ lbf.ft	√ in.oz	
↓ √ lbf.in	√ Kgf.m	
		√/X

Press '↓' to select.
Press '√/X' to enable/disable.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

4. SERIAL PORT

SERIAL PORT	
OK	EXIT
PARITY OFF	
DATA/STOP BITS 8-2	
BAUD RATE 9600	
OUTPUT LIMITS YES	↓
↓	EVEN/ODD/OFF


This menu consists of 2 screens:
Press '↓' to select.

Press  to change setting.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

SERIAL PORT	
OK	EXIT
OUTPUT LINE FEED NO	
FIRST CHARACTER -	
OUTPUT UNITS YES	
SET TO FACTORY DEFAULTS	↓
↓	YES/NO

5. THRESHOLDS

THRESHOLDS	
OK	EXIT
AUTO RESET HOLD TIME 1 SECONDS	
FIRST PEAK SENSITIVITY MED	
↓	1/2/3/4

Press '↓' to select.
Press  to change setting.
Press 'OK' for next menu.
Press 'EXIT' to end set up.

TIP. These settings only apply to 'CLICK & CAM' mode.


6. MODES



MODES	
OK	EXIT
√ DIAL & ELECTRONIC	
√ CLICK & CAM	
↓	√/X


Press '↓' to select.
Press '√/X' to enable/disable.
Press 'OK' or 'EXIT' to end set up.

LIMITS

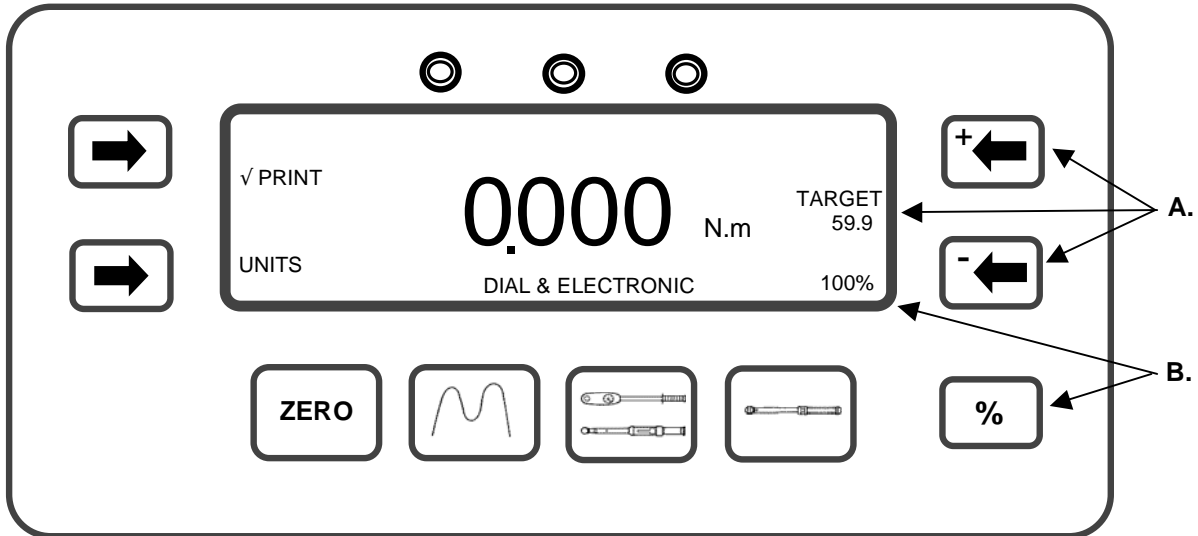ISO 6789:2003:-



A. To change the limit target value, use  or  in any measurement mode. The target value set is shown on the display. Keep either key depressed for fast target value change.

B. The three calibration points (20%, 60% & 100%) are selected by pressing . The percentage value selected is shown on the display.

The Pro-Test automatically calculates the limits to ISO 6789:2003 by the following method:

$$\text{Deviation} = \frac{(\text{Target value} - \text{Displayed reading})}{\text{Displayed reading}} \times 100$$

If the 100% target value is set above 10 Nm, the deviation must be within ± 4%. For a 100% target value of 10 Nm or below, the deviation must be within ± 6%.

TIP. For a 100 Nm target value a displayed reading of 96.14 Nm is a fail:

$$\text{Deviation} = \frac{100 - 96.14}{96.14} \times 100 = 4.015\% \text{ (larger than 4\% deviation).}$$

For a 100 Nm target value a displayed reading of 104.15 is a pass:

$$\text{Deviation} = \frac{100 - 104.15}{104.15} \times 100 = 3.985\% \text{ (smaller than 4\% deviation).}$$


TIP. For Indicating torque tools (Type I), the Pro-Test is designed for class B, C and E tools. Tools of class A and D should only be used with capacities of 10 N.m or below.

For Setting torque tools (Type II), the Pro-Test is programmed for Class A, B and C tools. Tools of class D, E, F and G should only be used with capacities of 10 N.m or below.



TIP. If the 100% target value is set to 54 Nm (for a Norbar SL1 wrench), the 20% target will be calculated as 10 Nm and the 60% target as 32 Nm.

TIP. The maximum target value in lbf.ft (ft lb) is 50 lbf.ft for the Pro-Test 60 and 300 lbf.ft for the Pro-Test 400.

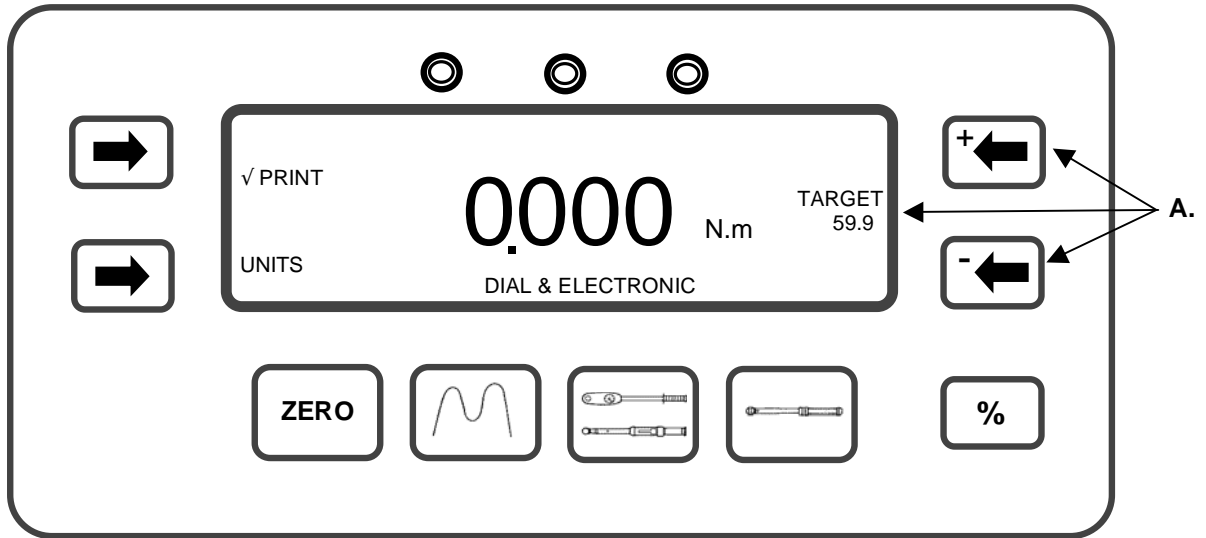NON ISO 6789:2003:- _____



NON ISO 6789:2003 limit mode allows the user to set upper and lower limits from 0% to 99% of the target value.

A. To change the limit target value, use  or  in any measurement mode. The target value set is shown on the display. Keep either key depressed for fast target value change.

UPPER LIMIT = TARGET + % OF TARGET

LOWER LIMIT = TARGET - % OF TARGET

The default % OF TARGET is set to 4%. See the SET UP section to change the default value.

OPERATION :- _____

Measurement mode	Limit operation
Track	Limits follow signal and are not held.
Dial & Electronic	Limits status is held until 'ZERO' is pressed.
Click & Cam	Limit status is held until after the auto reset timer has operated.

Limits are enabled to work in both the Clockwise and Counter clockwise directions.

STATUS INDICATION :- _____

Torque signal	Display	LED's	Serial port
Under lower limit	LO	Yellow	LO
Within limits	OK	Green	OK
Above upper limit	HI	Red	HI

SERIAL PORT

INTRODUCTION :-

The serial port is for sending data to a PC or serial printer.

Measurement mode	Data output operation
Track	When 'PRINT' is pressed.
Dial & Electronic	When 'ZERO' is pressed after a peak has been captured.
Click & Cam	Automatically after a first peak has been captured.

The data can include direction indication, limit status, measured value, units of measurement and line feed.

PARAMETERS :-

Parameter	Options	Factory Defaults	Comments
Parity	ODD, EVEN or OFF.	'OFF'	The Parity Bit used for Parity Error.
Data-Stop bits	8-2, 8-1, 7-2, 7-1.	'8-2'	The format per character.
Baud rate	1200, 2400, 4800, 9600 or 19200.	'9600'	The speed of data output.
Output Limits	YES or NO.	'YES'	Limit status sent before data.
Output line feed	YES or NO.	'NO'	Line feed sent after data.
First character	- /+ & - /NONE.	'-'	Character sent before the data.
Output units	YES or NO.	'YES'	Torque units sent after data.
	SET TO FACTORY DEFAULTS.		Reset all settings.

Maximum number of characters per line = 24.

Transmitted data voltage levels are between +5 to +9 volts and -5 to -9 volts.

Configured as DTE (Data Terminal Equipment) and conforms to RS-232-C specifications.

TIP. If the serial port is not communicating with other equipment try:

- a) Check that control word on the Pro-Test and the equipment receiving data match.
- b) Check that the baud rate is set to the same as the equipment receiving data.
- c) Check that the connecting lead is wired correctly at both ends if not using the lead supplied.
- d) Check if the equipment receiving data requires the units of measurement inhibited or a leading character.

TIP. If the serial output is being overwritten set 'OUTPUT LINE FEED' to YES.

HYPER TERMINAL® :- _____

The standard Hyper Terminal® program found in Microsoft® Windows allows the user to view and store serial port output data.

LIMIT OUTPUT :- _____

The serial port will output LO / OK / HI before the torque value when the limits are being used. Some software, including the Norbar 'Torque Wrench Calibration Software' (Part 37705.XXX), will not accept LO / OK / HI characters.

The following table gives all options for the FIRST CHARACTER setting and the OUTPUT LIMITS setting:

First character	Direction	Limits disabled Output limits = NO	Limits enabled Output limits = YES
-	Clockwise	1.0335 N.m	LO 1.0335 N.m
	Anti Clockwise	-1.0335 N.m	LO -1.0335 N.m
+ & -	Clockwise	+1.0335 N.m	LO +1.0335 N.m
	Anti Clockwise	-1.0335 N.m	LO -1.0335 N.m
NONE	Clockwise	1.0335 N.m	LO 1.0335 N.m
	Anti Clockwise	1.0335 N.m	LO 1.0335 N.m

PIN CONNECTIONS :- _____

Pin No	Function
1	Not Connected.
2	Received data (to Pro-Test).
3	Transmitted data (from Pro-Test).
4	Not Connected.
5	Signal ground 0V.
6	Not Connected.
7	Not Connected.
8	Not Connected.
9	Not Connected.

DATA OUTPUT EXAMPLE :- _____

Code : DP=Decimal Point. CR=Carriage Return. SP=Space.
Pro-Test with the serial port set to the factory defaults. Reading 1068.4 lbf.ft (clockwise).

1	0	6	8	DP	4	SP	l	b	f	DP	f	t	CR
---	---	---	---	----	---	----	---	---	---	----	---	---	----

CONNECTOR TYPE :- _____

9 way male 'D' type connector.

CONNECTING LEAD :- _____

A 9 way female to 9 way female null modem connecting cable is included with the Pro-Test for connection to PC's with a 9 way male connector. Alternatively use the Serial Data Lead Kit (part number 60248).

SPECIFICATIONS

Calibration range (2–100% of transducer capacity)	1.2 to 60 Nm (Pro-Test 60). 8 to 400 Nm (Pro-Test 400). 30 to 1500 Nm (Pro-Test 1500).
Resolution	5 digits.
Torque conversions	To 'BS 350:2004 Conversion factors for units'.
Display	240 x 64 pixel dot matrix display. Update rate of three times per second (3Hz) in 'TRACK'.
Accuracy	See calibration certificate.
Zero suppression	± 1 LSD in 'TRACK' mode for Pro-Test 60. No suppression for Pro-Test 400 & 1500. 'DIAL & ELECTRONIC' and 'CLICK & CAM' mode suppressed from 0 to approximately 0.5% of transducer capacity.
Units of measurement	N.m, dN.m, cN.m, lbf.ft, lbf.in, ozf.in, ft lb, in lb, in oz, kgf.m, kgf.cm & gf.m. PRO-TEST 60 also has gf.cm available.
First peak sensitivity	2.5%(High), 5%(Med), or 10%(Low) of reading.
Auto reset hold time	1, 2, 3 or 4 seconds.
Trigger from setting	1.55% of transducer capacity.
Limit hysteresis	0.5% of transducer capacity.
Operating temperature range	+5°C to +40°C.
Storage temperature range	-20°C to +70°C.
Maximum operating humidity	85% Relative Humidity @30°C.
Power supply	90 to 264 Volts a.c. at 50-60 Hz input. 9V, 300 mA D.C. output (centre positive).
Power consumption	2.25 W - maximum.
Power cable	2 meters (6 ft 6 ins) long minimum.
Power cable plug fuse (if fitted)	1 Amp.
Case materials / finish	Display and Transducer housings engineered in aluminium castings and finished in powder coated paint.
Environment	Indoor use within a light industrial environment.
Electromagnetic Compatibility (EMC) Directive	In conformance with EN 61326 : 1997.
Low voltage directive	In conformance with EN 61010-1 : 2001. To environmental conditions Pollution Degree 2 & Installation Category (Over voltage Category) II.
Mechanical overload	150% of marked transducer capacity.
Dimensions	Transducer 106 (H) x 106 (W) x 185 (D). Display 128 (H) x 185 (W) x 102 (D).
Weight (Transducer with display)	Pro-Test 60 = 6.3 kg (13.9 lb). Pro-Test 400 = 6.4 kg (13.12 lb). Pro-Test 1500 = 7.3 kg (15.11 lb).

Due to continuous improvement all specifications are subject to change without prior notice.

MAINTENANCE

PRO-TEST CALIBRATION :- _____

Your Pro-Test has been supplied with a certificate of calibration. To maintain the specified accuracy it is recommended that the Pro-Test is recalibrated at least once per year. Re-calibration should be carried out at Norbar or by a Norbar approved agent, where all the facilities to ensure the instrument is functioning at maximum accuracy are available.

Alternatively, procedures for calibrating the Pro-Test to the specified accuracy can be found in the Professional Torque Tester (Pro-Test) service manual Part No. 34301.

CLEANING:- _____

Do not use abrasives or solvent based cleaners.

DISPOSAL (RECYCLING CONSIDERATIONS):- _____

COMPONENT	MATERIAL
BACK PANEL	STAINLESS STEEL
TRANSDUCER SHAFT	STAINLESS STEEL
TRANSDUCER HOUSING	ALUMINIUM
DISPLAY HOUSING	ALUMINIUM

For up to date disposal information, see our web site www.norbar.com.